

LETTER OF TRANSMITTAL

TO Harlo T. Caslor  
P. O. Box 418  
Upland, California 91786

DATE	4-29-71	JOB NO.
ATTENTION		
RE: Glendora Library		

GENTLEMEN:

WE ARE SENDING YOU  Attached  Under separate cover via \_\_\_\_\_ the following items:

- Shop drawings       Prints       Plans       Samples       Specifications
- Copy of letter       Change order       \_\_\_\_\_

COPIES	DATE	NO.	DESCRIPTION
			copy of memo from Russ Connors Associates dtd 4-28-71


THESE ARE TRANSMITTED as checked below:

- For approval       Approved as submitted       Resubmit \_\_\_\_\_ copies for approval
- For your use       Approved as noted       Submit \_\_\_\_\_ copies for distribution
- As requested       Returned for corrections       Return \_\_\_\_\_ corrected prints
- For review and comment       \_\_\_\_\_
- FOR BIDS DUE \_\_\_\_\_ 19 \_\_\_\_\_  PRINTS RETURNED AFTER LOAN TO US

REMARKS \_\_\_\_\_

COPY TO  Art Cook

SIGNED: \_\_\_\_\_ E. ROGER WILLNER, AIA

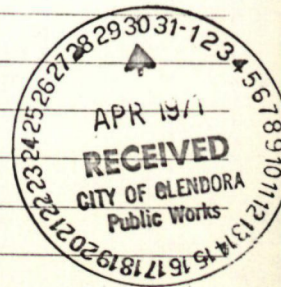

Phone (213) 869-7764 (714) 522-2036

TO

ANTHONY J. LANGFORD  
12422 E WITTNER BLVD  
WHITTIER, CALIF 90602

ATTN: ROGER WILNER

THE FOLLOWING WAS NOTED:

UPPER LEVEL IS FORMED, REBAR IN MOST JOISTS, BEAMS & GIRDS. ① BARS IN JOISTS & SOME BEAMS ARE LAID FAIRLY CLOSE TOGETHER; SINCE ROCK WILL BE 3/4" CONCRETE PUMPED, THIS CAN BE TOLERATED IF SPECIAL ATTENTION IS GIVEN TO PLACEMENT AND VIBRATION. ② #5 TOP BARS, BETWEEN NEGATIVE DESIGN STEEL, NEED HAVE ONLY 12" LAP, AS PER TYP. DET. ③ PETE POINTED OUT THAT FLOOR REGISTERS 72x65 PIERCE THE FLOOR NEAR THE ELEVATOR SHAFT (SEE DWG M-2) THIS IS OK FOR THE INTERIOR SLAB, BUT THE REBAR FOR THE CANOPY, SHOWN STRAIGHT ON DWG S-2, WILL REMAIN STRAIGHT BETWEEN THE REGISTER OPSS, BUT BEND DOWN AT THE INSIDE FACE OF BEAM B-3 FOR THE LENGTH OF REGISTERS ④ FORMS NOW CONTAIN A LOT OF DEBRIS. CHRIS WILL INSPECT, AND HOLD POUR TILL HE IS SATISFIED. ⑤ IF CONTRACTOR ELECTS TO MAKE A PARTIAL POUR, THE METHOD MUST BE DESCRIBED TO THIS OFFICE, AND APPROVED PRIOR TO POUR. ⑥ IT APPEARS THAT TWO INSPECTORS ARE REQUIRED AT THE POUR.

COPIES TO \_\_\_\_\_

FIELD INSPECTION REPORT

SIGNED BOB HOEFMAN

APR 29 1971

LOCATION

CONTRACTOR

OWNER

WEATHER

CCLOUDY

TEMP

° at

° at

AM

PM

PRESENT AT SITE

CHRIS PRENTICE

PETE FARLEY